

RENESAS TOOL NEWS on July 16, 2008: 080716/tn4

A Note on Using the Licensed Tools for Adding Device Groups to E10A-USB Emulators' Support Lines

Please take note of the problem described below in using the licensed tools for adding device groups to E10A-USB emulators' support lines. E10A-USB emulators are used for the SuperH RISC engine, H8S, and H8SX MCU families.

1. Products and Versions Concerned

The following licensed tools for adding device groups to E10A-USB emulators' support lines are concerned. They can only be used for the E10A-USB emulators HS0005KCU01H and HS0005KCU02H.

- (1) Licensed tool for the SH-4A device group:
HS7780KCU01SR V.2.00 Release 00 and V.3.00 Release 00
- (2) Licensed tool for the SH-4 device group:
HS7751KCU01SR V.2.00 Release 00 and V.3.00 Release 00
- (3) Licensed tool for the SH-3 device group:
HS7729KCU01SR V.2.00 Release 00 and V.3.00 Release 00
- (4) Licensed tool for the SH-2A device group:
HS7206KCU01SR V.2.00 Release 00 and V.3.00 Release 00
- (5) Licensed tool for the SH-2 device group:
HS7047KCU01SR V.2.00 Release 00 and V.3.00 Release 00
- (6) Licensed tool for the SH-Mobile device group:
HS7290KCU01SR V.2.00 Release 00 and V.3.00 Release 00
- (7) Licensed tool for the New_SH-Mobile device group:
HS7318KCU01SR V.2.00 Release 00 and V.3.00 Release 00
- (8) Licensed tool for the H8S device group:
HS2339KCU01SR V.2.00 Release 00 and V.3.00 Release 00
- (9) Licensed tool for the H8SX device group:
HS1527KCU01SR V.2.00 Release 00 and V.3.00 Release 00

For details of these licensed tools from here.

The above URL is that of our global site (in English).

2. Description

If any of the above license tools is installed to the host computer, the association of High-performance Embedded Workshop with workspace files (.hws files) is lost. So double-clicking the name of any workspace file will not invoke High-performance Embedded Workshop.

3. Solution

Download the update program to High-performance Embedded Workshop V.4.04.01 (the latest version) from the Web site shown below and reinstall the latest version of the High-performance Embedded Workshop (See NOTE.)

http://www.renesas.com/hew_download

The above URL is that of our global site (in English).

NOTE:

The following two types of update program are available. Use either of them:

- (a) Full-update program
- (b) Differential-update program

Or, use AutoUpdate Utility to update yours.

For details see RENESAS TOOL NEWS at

<http://tool-support.renesas.com/eng/toolnews/080118/tn1.htm>

The above URL is that of our global site (in English).

After the solution above has been executed, the problem occurs again when any of the product concerned is installed.

In that case, implement the solution again.

4. Schedule of Fixing the Problem

We plan to fix this problem in the next release of the license tools.

[Disclaimer]

The past news contents have been based on information at the time of publication. Now changed or invalid information may be included. The URLs in the Tool News also may be subject to change or become invalid without prior notice.