[Notes]

RX Family

R20TS0609EJ0100 Rev.1.00 Sep. 01, 2020

Clock Synchronous Control Module for Serial Flash Memory Access Firmware Integration Technology,

RX Driver Package

Outline

When using the products in the title, note the following point.

- 1. Notes on build when GPIO module Firmware Integration Technology and MPC module Firmware Integration Technology are used
- Notes on build when GPIO module Firmware Integration Technology and MPC module Firmware Integration Technology are used
- 1.1 Applicable Products
 - (1) Clock Synchronous Control Module for Serial Flash Memory Access Firmware Integration Technology (Serial Flash memory FIT module)

The applicable revision numbers and document numbers are as follows.

Table 1.1 Serial Flash memory FIT module applicable products

Revision number of the Serial Flash memory FIT module	Document number
Rev.3.01	R01AN2662EJ0301
Rev.3.00	R01AN2662EJ0300

(2) RX Driver Package

The Serial Flash memory FIT module in (1) is also included in the RX Driver Package. The product names and revision numbers of the applicable RX Driver Package and the revision numbers and documents of the included Serial Flash memory FIT module are as follows.

Table 1.2 Products which include the Serial Flash memory FIT module

RX Driver Package product name	RX Driver Package revision number	Document number	Revision number of the included Serial Flash memory FIT module
RX Family RX Driver Package Ver.1.26	Rev.1.26	R01AN5401EJ0126	Rev.3.01
RX Family RX Driver Package Ver.1.25	Rev.1.25	R01AN5371EJ0125	Rev.3.01
RX Family RX Driver Package Ver.1.24	Rev.1.24	R01AN5267EJ0124	Rev.3.01
RX Family RX Driver Package Ver.1.23	Rev.1.23	R01AN4976EJ0123	Rev.3.01
RX Family RX Driver Package Ver.1.22	Rev.1.22	R01AN4873EJ0122	Rev.3.01
RX Family RX Driver Package Ver.1.20	Rev.1.20	R01AN4794EJ0120	Rev.3.01
RX Family RX Driver Package Ver.1.19	Rev.1.19	R01AN4677EJ0119	Rev.3.00

1.2 Applicable Devices

RX Family

1.3 Details and Conditions

A warning and linkage errors arise during building when the following conditions are met.

- (a) CS+ Integrated Development Environment is used.
- (b) General I/O ports of the Serial Flash memory FIT module are controlled via both of the following FIT modules^(Note 1).
 - GPIO module using Firmware Integration Technology (GPIO FIT module)
 - MPC module using Firmware Integration Technology (MPC FIT module)

The following warning and linkage errors arise:

- W0561010:Duplicate file specified in option "input" : "DefaultBuild¥r_flash_spi_dev_port.obj"
- E0562310: Undefined external symbol "_r_flash_spi_cs_reset" referenced in "DefaultBuild¥r_flash_spi_type_sub.obj"
- E0562310: Undefined external symbol "_r_flash_spi_cs_init" referenced in "DefaultBuild¥r_flash_spi_type_sub.obj"
- E0562310: Undefined external symbol "_r_flash_spi_wait_lp" referenced in "DefaultBuild¥r_flash_spi_type_sub.obj"
- E0562310: Undefined external symbol "_r_flash_spi_set_cs" referenced in "DefaultBuild¥r_flash_spi_type_sub.obj"

Note 1: Specified by either of the following:

- The definition" FLASH SPI CFG USE GPIO MPC FIT" is set to 1 in" r flash spi config.h".
- The item ENABLE GPIO MODULE AND MPC MODULE is set to Enabled in the Smart Configurator.

1.4 Detailed Description

This phenomenon is caused by the combination of the following (1) to (3).

(1) Two source files for controlling general I/O ports of the Serial Flash memory FIT module have the same name.

Control settings for general I/O ports of the Chip Select pin (Port(SS#)) of the Serial Flash memory are specified by using either of the following. Note that the source file used in (a) and (b) is saved with the same file name in different folders.

- (a) "iodefine.h" is used(Note 1) (Default setting)
 - r_flash_spi\u00e4src\u00e4dev_port\u00e4using_iodefine\u00e4r_flash_spi_dev_port.c
- (b) GPIO FIT module and MPC FIT module are used
 - r_flash_spi\u00e4src\u00e4dev_port\u00e4using_gpio_fit_module\u00e4r_flash_spi_dev_port.c"

Note 1: The Serial Flash memory FIT module directly controls the ports.

(2) In CS+, an object file with the same name will be overwritten.

CS+ saves the generated object file in the same folder. If an object file with the same name is generated, the existing file will be overwritten with the object file most-recently generated.

Therefore, if you control general I/O ports of the Serial Flash memory FIT module using (1) (b), the file will be ultimately overwritten by the object file (r_flash_spi_dev_port.obj) generated from (1) (a).



(3) Functions in either the source file (1) (a) or (1) (b) are enabled.

For source files (1) (a) and (1) (b), the same names are used for functions that perform different tasks. For these functions with the same names, only the functions chosen by #ifdef condition ("FLASH_SPI_CFG_USE_GPIO_MPC_FIT" definition) in both source files are enabled. All other unselected functions in the source files are disabled.

Therefore, if (1) (b) is selected, all the functions with the same names in (1) (a) "r_flash_spi\u224src\u224dev_port\u224susing_iodefine\u224r_flash_spi_dev_port.c" are disabled by #ifdef, and symbols of the functions no longer exist.

1.5 Workarounds

Change the names of the source files with the same name, as described in 1.4 (1) (a) and (b), to names that are not used in the Serial Flash memory FIT module.

The following shows an example of changing the names.

- Change From: "r_flash_spi\u224src\u224dev_port\u224susing_iodefine\u224r_flash_spi_dev_port.c" →
 Change To: "r flash spi\u224src\u224dev port\u224susing iodefine\u224r flash spi dev port iodefine.c"
- Change From: "r_flash_spi\u00e4src\u00e4dev_port\u00e4using_gpio_fit_module\u00e4r_flash_spi_dev_port.c" →
 Change To: "r flash spi\u00e4src\u00e4dev port\u00e4using gpio fit module \u00e4r flash spi dev port gpio.c"

1.6 Schedule for Fixing the Problem

This problem will be fixed in the next version.



Revision History

		Description	
Rev.	Date	Page	Summary
1.00	Sep.01.20	-	First edition issued

Renesas Electronics has used reasonable care in preparing the information included in this document, but Renesas Electronics does not warrant that such information is error free. Renesas Electronics assumes no liability whatsoever for any damages incurred by you resulting from errors in or omissions from the information included herein.

The past news contents have been based on information at the time of publication. Now changed or invalid information may be included.

The URL in the Tool News also may be subject to change or become invalid without prior notice.

Corporate Headquarters

TOYOSU FORESIA, 3- 2- 24 Toyosu, Koto-ku, Tokyo 135- 0061, Japan www.renesas.com

Trademarks

Renesas and the Renesas logo are trademarks of Renesas Electronics Corporation. All trademarks and registered trademarks are the property of their respective owners.

Contact information

For further information on a product, technology, the most up-to-date version of a document, or your nearest sales office, please visit: www.renesas.com/contact/

 $\hbox{@}$ 2020 Renesas Electronics Corporation. All rights reserved.

TS Colophon 4.1